

>> MG90 4.0.4 Release Notes

MG90 4.0.4 is for MG90 routers.

Important: *If you want to update OTA (Over The Air), you must first update your software to MG90 4.0.3, then update to MG90 4.0.4.*

Addressed Issues

NXP DDR Erratum N-009942


Resolved issue with potential intermittent boot failure

Known Issues

GPS/GNSS LAN UDP Broadcast

The broadcast address is calculated incorrectly for LAN segments defined with a /29 netmask (255.255.255.248) for local sentence forwarding.

To avoid this issue, set the Network Mask in each of those LAN segments (LAN > LAN Segments) to 255.255.255.0.

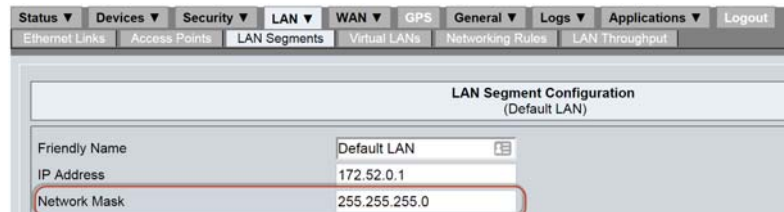


LAN Segment Configuration (Default LAN)	
Friendly Name	Default LAN
IP Address	172.52.0.1
Network Mask	255.255.255.0

12 Lead Transmission Devices

- Physio Control LIFEPAK—The default Server URL in the LCI's Physio Control Configuration screen is incorrect.

To resolve this issue, manually set the Server URL in Applications > Physio Control to www.lifenetsystems.com.

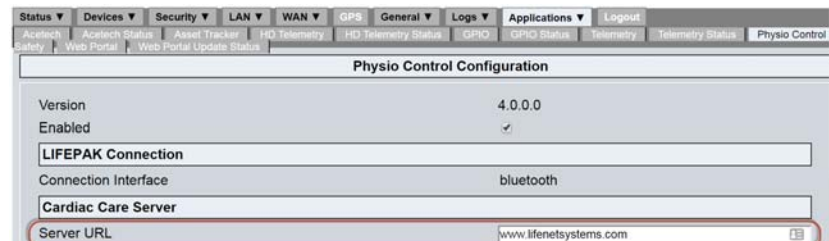

Physio Control Configuration	
Version	4.0.0.0
Enabled	<input checked="" type="checkbox"/>
LIFEPAK Connection	
Connection Interface	bluetooth
Cardiac Care Server	
Server URL	www.lifenetsystems.com

Refer to the LIFEPAK Application Configuration Guide for details.

- **Physio Control LIFEPAK**—The LIFEPAK may intermittently fail to connect to the MG90.
To avoid this issue, contact Sierra Wireless Technical Support to apply a log monitor configuration.
- **All 12 Lead Transmission Devices**—The device may not be able to pair with the MG90's built-in Bluetooth.
To avoid this issue, contact Sierra Wireless Technical Support to apply a postWAN configuration.

Sierra Wireless Contact Information

Sales information and technical support, including warranty and returns:

Web: sierrawireless.com/company/contact-us/

Global toll-free number: 1-877-687-7795

Corporate and product information: sierrawireless.com