


>> oMG 3.14.5 Release Notes

oMG 3.14.5 is for oMG2000 and oMG500 gateways.

*Note: After using the AMM to push the oMG 3.14.5 FIPS update to the oMG gateway, the AMM **Last update status** does not indicate the actual status. To verify the update succeeded, compare the **Current version** with the **Target version** on the Admin screen.*

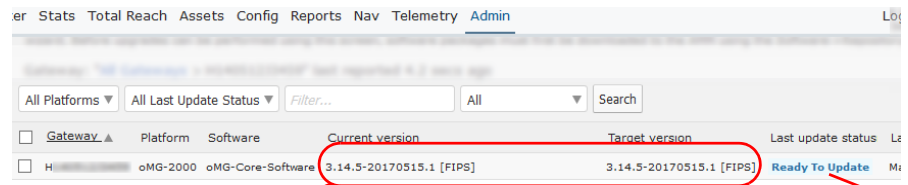

Gateway	Platform	Software	Current version	Target version	Last update status
H1	oMG-2000	oMG-Core-Software	3.14.5-20170515.1 [FIPS]	3.14.5-20170515.1 [FIPS]	Ready To Update

Update 3.14.5 is installed (Current version = Target version)

Ignore

New Features

Automatic Software Updates

Added feature to LCI to allow scheduling of installation of automatically downloaded software.

Addressed Issues

Upgrade requirements from Sierra Wireless Technical Bulletin: oMG 3.14.4.2 Upgrade (24 March 2017)

Implemented solution to enable direct upgrade to 3.14.5 without the need to go through an intermediate version as indicated in the “oMG 3.14.4.2 Upgrade” technical bulletin (Date of issue: 24 March 2017). This technical bulletin is now obsolete.

Bluetooth

Resolved an issue where devices could not “re-pair” with specific Sena UD100 Bluetooth adapters used with oMG2000 gateways. (Issue affected specific production runs of the adapter.)

WAN

Resolved an issue where rapid and repeated WAN link switching could cause a CPU runaway condition.

Resolved routing issues with MC7354 and GD Band14 radio modules by assigning fixed 32-bit subnet masks (255.255.255.255) to them.

Resolved an issue where custom APN could not be assigned on gateway using Novatel E371 radio module

Sierra Wireless Contact Information

Sales information and technical support, including warranty and returns:

Web: sierrawireless.com/company/contact-us/

Global toll-free number: 1-877-687-7795

Corporate and product information: sierrawireless.com